

[illegible]

1
 2
 3
 4
 5
 6
 7
 8
 9
 10
 11
 12
 13
 14
 15
 16
 17
 18
 19
 20
 21
 22
 23
 24
 25
 26
 27
 28
 29
 30
 31
 32
 33
 34
 35
 36
 37
 38
 39
 40
 41
 42
 43
 44
 45
 46
 47
 48
 49
 50
 51
 52
 53
 54
 55
 56
 57
 58
 59
 60
 61
 62
 63
 64
 65
 66
 67
 68
 69
 70
 71
 72
 73
 74
 75
 76
 77
 78
 79
 80
 81
 82
 83
 84
 85
 86
 87
 88
 89
 90
 91
 92
 93
 94
 95
 96
 97
 98
 99
 100
 101
 102
 103
 104
 105
 106
 107
 108
 109
 110
 111
 112
 113
 114
 115
 116
 117
 118
 119
 120
 121
 122
 123
 124
 125
 126
 127
 128
 129
 130
 131
 132
 133
 134
 135
 136
 137
 138
 139
 140
 141
 142
 143
 144
 145
 146
 147
 148
 149
 150
 151
 152
 153
 154
 155
 156
 157
 158
 159
 160
 161
 162
 163
 164
 165
 166
 167
 168
 169
 170
 171
 172
 173
 174
 175
 176
 177
 178
 179
 180
 181
 182
 183
 184
 185
 186
 187
 188
 189
 190
 191
 192
 193
 194
 195
 196
 197
 198
 199
 200
 201
 202
 203
 204
 205
 206
 207
 208
 209
 210
 211
 212
 213
 214
 215
 216
 217
 218
 219
 220
 221
 222
 223
 224
 225
 226
 227
 228
 229
 230
 231
 232
 233
 234
 235
 236
 237
 238
 239
 240
 241
 242
 243
 244
 245
 246
 247
 248
 249
 250
 251
 252
 253
 254
 255
 256
 257
 258
 259
 260
 261
 262
 263
 264
 265
 266
 267
 268
 269
 270
 271
 272
 273
 274
 275
 276
 277
 278
 279
 280
 281
 282
 283
 284
 285
 286
 287
 288
 289
 290
 291
 292
 293
 294
 295
 296
 297
 298
 299
 300
 301
 302
 303
 304
 305
 306
 307
 308
 309
 310
 311
 312
 313
 314
 315
 316
 317
 318
 319
 320
 321
 322
 323
 324
 325
 326
 327
 328
 329
 330
 331
 332
 333
 334
 335
 336
 337
 338
 339
 340
 341
 342
 343
 344
 345
 346
 347
 348
 349
 350
 351
 352
 353
 354
 355
 356
 357
 358
 359
 360
 361
 362
 363
 364
 365
 366
 367
 368
 369
 370
 371
 372
 373
 374
 375
 376
 377
 378
 379
 380
 381
 382
 383
 384
 385
 386
 387
 388
 389
 390
 391
 392
 393
 394
 395
 396
 397
 398
 399
 400
 401
 402
 403
 404
 405
 406
 407
 408
 409
 410
 411
 412
 413
 414
 415
 416
 417
 418
 419
 420
 421
 422
 423
 424
 425
 426
 427
 428
 429
 430
 431
 432
 433
 434
 435
 436
 437
 438
 439
 440
 441
 442
 443
 444
 445
 446
 447
 448
 449
 450
 451
 452
 453
 454
 455
 456
 457
 458
 459
 460
 461
 462
 463
 464
 465
 466
 467
 468
 469
 470
 471
 472
 473
 474
 475
 476
 477
 478
 479
 480
 481
 482
 483
 484
 485
 486
 487
 488
 489
 490
 491
 492
 493
 494
 495
 496
 497
 498
 499
 500
 501
 502
 503
 504
 505
 506
 507
 508
 509
 510
 511
 512
 513
 514
 515
 516
 517
 518
 519
 520
 521
 522
 523
 524
 525

1.0 DC DOCUMENT CONTROL



Photocopy D205-634 bluefile & type labels per PPP D205-634 CHG001

KS 07.03.23 (1)

2.0	D25001190	Ext'n - l' Beam Tube 4"
-----	-----------	-------------------------



Qty	Part Number	Description	Batch
1	D2500-1-190	Skid Tube Extrusion	B 29602

JD 7-3-19

3.0 D2596 205 Web



Qty	Part Number	Description	Batch
1	D2596	205 Web	B 31110

5b 7-3-21

4.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------



- 1- Inspect mat'l D2500-1-190 for damage
- 2-Cut D2500-1-190 per Dwg D2580 if necessaryDeburr ends
- 3-Acid etch and Alodine tube per QSI 005 4.1
- 4-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

JD 7-3-19

5b7-3-21

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B		Sign & Date	Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng				

NOTE: Date & initial all entries

Date: Wednesday, 3/14/2007 3:26:20 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 31207

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description:

5-Open holes to 0.500" as per Dwg D2580 without cutting fluid

6-Countersink holes as per Dwg D2580 without cutting fluid

7-Deburr and blow out all chips from inside of tube

8-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 M103497

Sikaflex expire date: 7-10-1

Start Time: 9:00 Date: 7-3-21

Fin Time: 3:30 Date: 7-3-28

507-3-21

5.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

EL 7-3-28

6.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends after cutting. Remove alodine from around holes

07-04-03

7.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

BE 07-04-03

8.0

D25763

Step (Machining Detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
1 D2576-3 Step B229486

BE 07-04-03

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 3/14/2007 3:26:20 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 31207

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
20	D2579	Spacers	<i>B 30220 BE 07-04-03</i>

10.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Prepare tube for welding D2576-3 StepRemove alodine as required.

BE 07-04-03

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

m103317 BE 07-04-03

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

m103317 BE 07-04-03

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

fm 07-04-03 ①

5-Drill holes for wearplates using DT 8217Open holes to 19/64", adjust stopper not to hit web. Deburr

fm 07-04-03 ①

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Deburr holes

fm 07-04-03 ①

7-Drill pilot holes for aft cap using DT 8215Open holes to #6 Drill bit. Deburr

fm 07-04-03 ①

8-Drill pilot holes for Tow ring using DT8091, open to .640"and Deburr

fm 07-04-03 ①

11.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

07/04/05

12.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

07/04/05

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 3/14/2007 3:26:20 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 31207

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1
Pressure wash as per QSI 005

JS

0704.10

①

14.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING
Powder Coat White Gloss (Ref. 4.3.5.1) as per QSI 005 4.3

JS

0704-16

①

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

M-L

07/04/17

①

16.0

D25771

Wearplate Fwd



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description
1	D2577-1	Wearplate

Batch

B29994

17.0

D25773

Wearplate Aft



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description
1	D2577-3	Wearplate

Batch

B29960

18.0

D25775

Wearplate, Centre



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description
1	D2577-5	Wearplate

Batch

B31254

FL

07/04/17 ①

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 31207

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

19.0

ALS71032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number Description
44 ALS7-1032-130 Inserts

Batch

m103495

20.0

AN960JD10L

Washer



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number Description
44 AN960JD10L Washer

Batch

m102832

21.0

AN34A

Bolt



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number Description
44 AN3-4A Bolt

Batch

m100857

22.0

D25941

Plug



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

plug

Batch: B30140

23.0

D25943

O-Ring



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

o-ring

Batch: B27168

24.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: B27488

FL

07/04/17 Q

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 3/14/2007 3:26:20 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 31207

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description:

25.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bolt

Batch: m15205

26.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

Batch: m102832

SL

07/04/17 ①

27.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R

Sikaflex-291

m103497

Sikaflex expire date: 07/10

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R

Sikaflex-291

m103497

Sikaflex expire date: 07/10

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

m103707

SL

Batch:

07/04/18 ①

28.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

29.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location:

PPP Rev: F

07/04/19 07/04/18

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: Q Date: 07/04/19
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 3/14/2007 3:26:20 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 31207

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

①
D205634041

Job Completion



U 07.04.19

31207

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. C SHEET 1 OF 2
DATE 98.08.26		TITLE 205 SKIDTUBE ASSEMBLY SCALE NTS	
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	

RELEASED
98/09/17 DS

QTY	Part Number	Description
X	D2580-041	SKIDTUBE ASSEMBLY
*	D2500-1	EXTRUSION
1	D2596	205 WEB
1	D2575	AFT CAP
1	D2576 - 3	STEP
20	D2579	CROSS BOLT SPACER
16	D2594-1	PLUG
16	D2594-3	O-RING
1	D2577-1	WEARSHOE
1	D2577-3	WEARSHOE
1	D2577-5	WEARSHOE
44	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or ALS4-1032-130	INSERT
46	AN3-4A	BOLT
46	AN960JD10L	WASHER

05.08.28
P 01.08.28

EFFECTIVE DEOS
DEC 9 12 4 1998
DEC 9 12 4 1998

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) LENGTH OF D2500-1 EXTRUSION BEFORE BENDING = 190 INCHES *
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (44 PLACES) AFTER FINISH. INSTALL AN3-4A BOLTS AND AN960JD10L WASHERS WITH SIKAFLEX-241.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE

Diagram illustrating the underside of the propeller with grinding locations marked:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- 800576 STEP
- GRIND FLUSH
- LOCATION RIDGE ON UNDERSIDE OF D2576

Technical drawing of a bolted joint assembly. The drawing shows a cross-section of a bolt and nut assembly. The bolt is labeled "AN3-4A BOLT (1)" and the nut is labeled "AN96QJ10L WASHER (1) (2 PLACES)". The bolt is shown with a diameter of "0.208" and a length of "0.40". The nut is shown with a diameter of "0.208" and a length of "0.40". The bolt is shown with a thread of "D2575" and the nut is shown with a thread of "D2575". The drawing also includes a callout "SEAL WITH SIKAFLEX-241" pointing to the sealant application area.

D2579 SPACER

D2596 WEB (REF)

ALS7-1032-130 (REF)
(TYP. 44 PLACES)

AFTER PERFORM


1. CHA
2. INS
3. WEI
4. C'B

UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 31207

37.50
DISTANCE TO AFT END
OF D2596 WEB
3 7
REFER TO DETAIL A
1.750 1.750
8.750 17.375 26.000 34.188
57.313 (REF)
7 EQUAL SPACES
8.188 PITCH
38.0 91.500 190.0
(D2500-1)
#0.508 (TYP.)
(40 PLACES)
REFER TO DETAIL A

[illegible]

RELEASED
98/07/17 DS

DESIGN <i>DAH</i>	DRAWN BY <i>CF</i>	 DART AEROSPACE LTD HAWKSBURY, ONTARIO, CANADA
CHECKED <i>DAH</i>	APPROVED <i>JS</i>	
DATE 98.08.26	DRAWING NO. D2580	REV. C SHEET 2 OF 2 SCALE 1:24
TITLE 205 SKIDTUBE ASSEMBLY		

NO. 101

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Barclay Elliott
Joint Welding Procedure Tig
Part number and Job number D205634041 / B31181 A

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS Tig
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input checked="" type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input checked="" type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input checked="" type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input checked="" type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into _____ Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07/03/29 Qualifier David Newell